

Manhole Inspection Summary

Manhole # S330__046MH

Printed On: 3/9/2009

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **330** Node: **046** Status: **Found**

Insp Date: **3/18/08 11:30 AM**

Incomplete Comments

Crew: **5**
Inspector: **jjoirer**
Firm: **ATS**

Location Address: **190 hamburg**

Cross Street: **sharp**

Manhole Type: **Terminal**

Location: **Roadway**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover

Shape: **Circular**

Diameter: **32** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **3** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment

☒ Exists Material: **Brick and Concrete** ☐ Parged Height: **3** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Loose Brick** ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☐ Roots ☐ Wall

Bench

☐ Exists Material:

☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth: **0**

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

Steps

Count: **6** Missing: **1** ☒ **Corroded**

Surcharge

☒ **Evidence Of Surcharge** Depth: **4** (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S33O__046MH


Printed On: 3/9/2009

Page 2 of 4

Location View



Top View

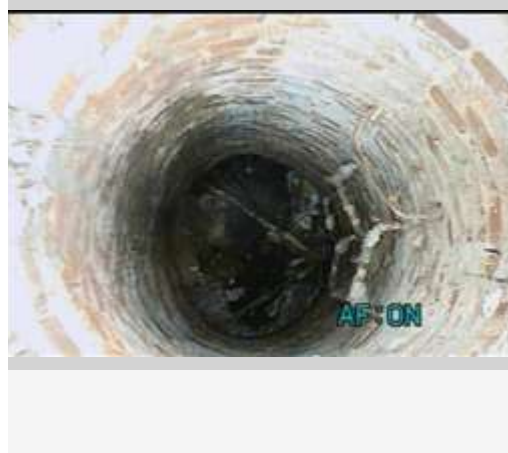

Defect 6



SURCHARGE

Defect 5



channel debris

Defect 4



infiltration marks on barrel

Defect 3



infiltration marks

Defect 2



steps

Defect 1



chimney loose bricks, offset

Manhole Inspection Summary

Manhole # S33O__046MH

Printed On: 3/9/2009

Page 4 of 4

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: 11.35 (ft.) Flow Characteristics: **None**

Deposits: ☐ None ☒ **Mud** ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 1 (in.) Deposits Extent: **Light**

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection